



# FIRE TEST REPORT

**FP11420-002**

**BUSH FIRE TEST ON WEEPA VENT 11-HPBW IN A  
BRICK VEENER WALL IN ACCORDANCE WITH  
AS 1530.8.1:2018**

**CLIENT**

Weepa Products Pty Ltd  
3/15 Donkin Street,  
West End,  
Queensland 4101  
Australia



National Association of Testing Authorities, Australia (NATA) & International Accreditation New Zealand (IANZ) are signatories to ILAC Mutual Recognition Agreement. Report users are recommended to accept test reports in the name of either



REPORT NUMBER:

**FP11420-002**

ISSUE DATE:

**4 November 2019**

PAGE:

**1 of 14**

THE LEGAL VALIDITY OF THIS REPORT CAN ONLY BE CLAIMED ON PRESENTATION OF THE COMPLETE SIGNED PAPER REPORT.  
EXTRACTS OR ABRIDGMENTS OF THIS REPORT SHALL NOT BE PUBLISHED WITHOUT PERMISSION FROM BRANZ LTD.

# TEST SUMMARY

## Objective

To determine the bush fire performance of a Weepa vent model No. 11-HPBW PVC grate with SS mesh when installed in a brick veneer wall and tested in accordance with AS 1530.8.1:2018 “Methods for fire tests on building materials, components and structures, Part 8.1: Tests on elements of construction for buildings exposed to simulated bushfire attack – Radiant heat and small flaming sources.”

## Test sponsor

Weepa Products Pty Ltd  
3/15 Donkin Street,  
West End,  
Queensland 4101  
Australia

## Description of test specimen

The Weepa model No. 11-HPBW consisted of a polypropylene body with a PVC grate with a stainless steel mesh installed into a brick veneer wall.

## Date of test

10<sup>th</sup> April 2019

## Test results

The Weepa model No. 11-HPBW tested in accordance with AS 1530.8.1:2018, Methods for fire tests on building materials, components and structures – Part 8.1: tests on element of construction for buildings exposed to simulated bushfire attack – Radiant heat and small flaming sources achieved the following rating:

Bushfire Attack Level BAL-A19

*“This report details the methods of construction, the test conditions and the results obtained when the specific element of construction described herein was tested in accordance with test method of AS1530.8.1.”*

## LIMITATION

The results reported here relate only to the item/s tested.

## TERMS AND CONDITIONS

This report is issued in accordance with the Terms and Conditions as detailed and agreed in the BRANZ Services Agreement for this work.



REPORT NUMBER:

**FP11420-002**

ISSUE DATE:

**4 November 2019**

PAGE:

**2 of 14**

THE LEGAL VALIDITY OF THIS REPORT CAN ONLY BE CLAIMED ON PRESENTATION OF THE COMPLETE SIGNED PAPER REPORT.  
EXTRACTS OR ABRIDGMENTS OF THIS REPORT SHALL NOT BE PUBLISHED WITHOUT PERMISSION FROM BRANZ LTD.



## TO WHOM IT MAY CONCERN

Both NATA (National Association of Testing Authorities, Australia) and IANZ (International Accreditation New Zealand) are signatories to the ILAC Mutual Recognition Arrangement. Under the terms of this arrangement, each signatory:

- (i) recognises within its scope of recognition of this Arrangement the accreditation of an organisation by other signatories as being equivalent to an accreditation by its own organisation,
- (ii) accepts, for its own purposes, endorsed\* certificates or reports issued by organisations accredited by other signatories on the same basis as it accepts endorsed\* certificates or reports issued by its own accredited organisations,
- (iii) recommends and promotes the acceptance by users in its economy of endorsed\* certificates and reports,

\* The word "endorsed" means a certificate or report bearing an Arrangement signatory's accreditation symbol (or mark) preferably combined with the ILAC-MRA Mark.

Signed:

  
Jennifer Evans  
NATA CEO

  
Dr Llewellyn Richards  
IANZ CEO

Date: 24 March 2014

Date: 24<sup>th</sup> March 2014



REPORT NUMBER:

**FP11420-002**

ISSUE DATE:

**4 November 2019**

PAGE:

**3 of 14**

THE LEGAL VALIDITY OF THIS REPORT CAN ONLY BE CLAIMED ON PRESENTATION OF THE COMPLETE SIGNED PAPER REPORT.  
EXTRACTS OR ABRIDGMENTS OF THIS REPORT SHALL NOT BE PUBLISHED WITHOUT PERMISSION FROM BRANZ LTD.

# CONTENTS

<b>SIGNATORIES .....</b>	<b>5</b>
<b>DOCUMENT REVISION STATUS .....</b>	<b>5</b>
<b>1. TEST PROCEDURE.....</b>	<b>6</b>
<b>2. DESCRIPTION OF TEST SPECIMEN .....</b>	<b>7</b>
2.1 General.....	7
2.1.1 Weepa 11-HPBW .....	7
2.1.2 Wall.....	7
2.1.3 Conditioning .....	7
2.1.4 Material Selection .....	7
<b>3. TEST CONDITIONS AND RESULTS .....</b>	<b>8</b>
3.1 General.....	8
3.2 Test procedure .....	8
3.3 Timber crib Class A .....	8
3.4 Radiation Measurements .....	9
3.5 Test conditions .....	9
3.5.1 Bushfire radiant heat test profile.....	9
3.6 Specimen Temperature Measurement.....	10
3.7 Insulation.....	10
3.8 Observations .....	11
3.9 Performance criteria.....	12
<b>4. SUMMARY .....</b>	<b>12</b>
<b>5. APPLICATION OF RESULTS.....</b>	<b>12</b>

## FIGURES

Figure 1: Test heat flux profile.....	9
Figure 2: Thermocouple Locations .....	10
Figure 3: Unexposed Wall Temperature Rise.....	11

## TABLES

Table 1: Standard radiant heat test profile BAL19 .....	9
Table 2: Test Observations .....	11
Table 3: Performance criteria .....	12

## PHOTOS

Photo 1: Test specimen exposed face before start of test .....	13
Photo 2: Test specimen exposed face with crib.....	13
Photo 3: Test specimen exposed face at the end of the test .....	14
Photo 4: Test specimen during removal from the wall .....	14



REPORT NUMBER:

**FP11420-002**

ISSUE DATE:

**4 November 2019**

PAGE:

**4 of 14**


THE LEGAL VALIDITY OF THIS REPORT CAN ONLY BE CLAIMED ON PRESENTATION OF THE COMPLETE SIGNED PAPER REPORT.  
EXTRACTS OR ABRIDGMENTS OF THIS REPORT SHALL NOT BE PUBLISHED WITHOUT PERMISSION FROM BRANZ LTD.

## SIGNATORIES



### Author

P. Chapman  
Senior Fire Testing Engineer  
IANZ Approved Signatory

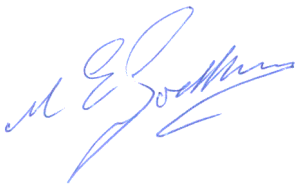

### Reviewer

M. E. Godkin  
Senior Fire Safety Engineer  
BRANZ

## DOCUMENT REVISION STATUS

ISSUE NO.	DATE ISSUED	DESCRIPTION
01	4 November 2019	Initial Issue



REPORT NUMBER:

**FP11420-002**

ISSUE DATE:

**4 November 2019**

PAGE:

**5 of 14**

THE LEGAL VALIDITY OF THIS REPORT CAN ONLY BE CLAIMED ON PRESENTATION OF THE COMPLETE SIGNED PAPER REPORT.  
EXTRACTS OR ABRIDGMENTS OF THIS REPORT SHALL NOT BE PUBLISHED WITHOUT PERMISSION FROM BRANZ LTD.